10000003



WARRANTY BULLETIN WB02-01

135 East 1" Avenue • P.O. Box 400 • Junction City, Oregon 97448 • (500)547-8015 • (541)998-3720 • (541)998-9272 [FAX]

Data: 24 June 2002

Subject: Burglar Alarm System

Application:

This Warranty Bulletin covers the optional burglar alarm system on certain models of Intrigue and Allure motor homes.

Symptom:

Burglar alarm system will not fully arm.

Corrective Action:

Install a relay behind the motion sensor to make the motion sensor compatible with the burglar alarm. The burglar alarm needs a signal to sense an alarm event. Without the relay, the motion sensor removes the signal the burglar alarm needs to begin an alarm event. See attached procedure and drawing.

Procedure:

- Upon receipt of this Bulletin, contact the Country Coach Technical Service
 Department at 1 (800) 452-8015 and select option #3 on the automated phone
 menu. A Service Representative will assist you in locating a Service Center to
 perform the necessary repair.
- Upon making your appointment please have the selected Service Center contact
 the Country Coach Parts Department at 1 (800) 452-8015 and select option #1
 on the automated phone menu. This will ensure that the necessary replacement
 part is available for your appointment.
- Please take the enclosed Warranty Claim to the selected Service Center on the date that your work is to be completed. The Warranty Claim is to be completed by the Service Center and is to be forwarded, with an itemized invoice, to County Coach, Inc. in the enclosed postage paid, self addressed envelope.
- 4. If you have sold or traded your motor home, please complete and return the enclosed Vehicle Reply Card. A postage paid, self-addressed envelope has been attached to the form for your convenience.
- This repair will be performed at no charge to you for necessary labor and parts. Labor time allowed is three-quarter (3/4) hour.

THIS SERVICE BULLETIN EXPIRES JUNE 30, 2003

[COO 0003



135 Bast 1st Avenue • P.O. Box 400 • Junction City, Oregon 97448 • (800)547-8015 • (541)998-3720 • (541)998-9272 [FAX]

WARRANTY BULLETIN 02-01 — Revised 07-03-02 PROCEDURE FOR ADDING RELAY

- Locate the motion sensor (item 4 on drawing) on the face of the center of the dash panel near the floor.
- 2. Remove the motion sensor from the dash.
- Use a standard Bosch (single pole, double throw) relay (CC# 02932) (Item 12 on drawing) and add it behind the motion sensor.
- Wire #263A (orange 16 ga.) is the power wire and is attached to the motion sensor's red wire and post 86 on the new relay.
- The ground wire (green 16 ga.) connects to both the green and black wires on the motion sensor.
- The output wire from the motion sensor is the white wire and it connects to post 85 on the new relay.
- Wire #382 (yellow 16 ga.) connects 67A on the new relay.
- Please refer to the attached drawing (S0652.H) for the above connections.
- Push relay into dash cutout for motion sensor.
- Replace motion sensor into dash cutout and secure.
- Test burgler elemn and sensor for proper operation.

10000003