

REPORT NUMBER: 114-CAL-04-04

**SAFETY COMPLIANCE TESTING FOR
FMVSS No. 114
THEFT PROTECTION**

**MITSUBISHI MOTORS NORTH AMERICA, INC.
2004 MITSUBISHI ENDEAVOR 4-DOOR MPV**

NHTSA NUMBER: C45601

GENERAL DYNAMICS TEST NUMBER: 8655-F214-04

**GENERAL DYNAMICS
ADVANCED INFORMATION ENGINEERING SERVICES
TRANSPORTATION SCIENCES CENTER
P.O. BOX 400
BUFFALO, NEW YORK 14225**




April 28, 2004

FINAL REPORT


**U. S. DEPARTMENT OF TRANSPORTATION
National Highway Traffic Safety Administration
Enforcement
Office of Vehicle Safety Compliance
400 Seventh Street, SW
Room No. 6115 (NVS-220)
Washington, DC 20590**

This publication is distributed by the U.S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned, it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Prepared By:

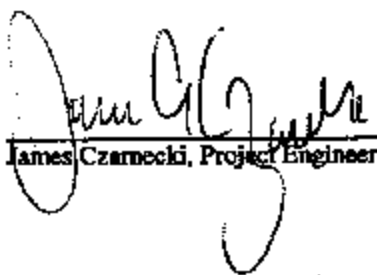
James Czarnecki, Project Engineer

Approved By:

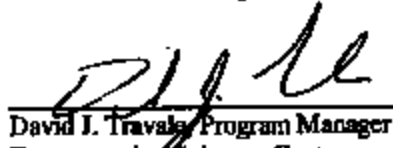

David J. Travala, Program Manager
Transportation Sciences Center

Approval Date:

April 28, 2004

FINAL REPORT ACCEPTANCE BY OVSC:

Accepted By:

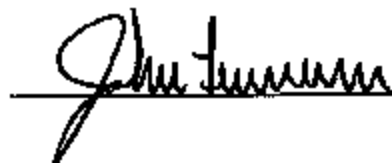

Acceptance Date:

5/18/04

TECHNICAL REPORT STANDARD TITLE PAGE

1. Report No. 114-CAL-04-04	2. Government Accession No.	3. Recipient's Catalog No.	
4. Title and Subtitle Final Report of FMVSS 114 Compliance Testing of a 2004 Mitsubishi Endeavor 4-door MPV NHTSA No.: C45601		5. Report Date April 28, 2004	
		6. Performing Organization Code CAL	
7. Author(s) James Czamecki, Project Engineer David J. Travala, Program Manager		8. Performing Organization Report No. 8655-F214-04	
9. Performing Organization Name and Address General Dynamics Advanced Information Engineering Services Transportation Sciences Center P.O. Box 400 Buffalo, New York 14225		10. Work Unit No.	
		11. Contract or Grant No. DTNH22-01-C-01025	
12. Sponsoring Agency Name and Address U.S. Department of Transportation National Highway Traffic Safety Administration Enforcement Office of Vehicle Safety Compliance (NVS-220) 400 Seventh Street, SW, Rm. 6115 Washington, D.C. 20590		13. Type of Report and Period Covered Final Report, April 13 - April 28, 2004	
		14. Sponsoring Agency Code NVS-220	
15. Supplementary Notes			
16. Abstract Compliance tests were conducted on the subject 2004 Mitsubishi Endeavor 4-door MPV in accordance with the specifications of the Office of Vehicle Safety Compliance Test Procedure No. TP-114-01 for the determination of FMVSS 114 compliance. Test failures were identified as follows: None			
17. Key Words Compliance Testing Safety Engineering FMVSS 114		18. Distribution Statement Copies of this report are available from: NHTSA Technical Information Services (TIS) Room 5108 (NAD-40) 400 Seventh Street, SW Washington, D.C. 20590 Telephone No. (202) 366-2588	
19. Security Classification of Report UNCLASSIFIED	20. Security Classification of Page UNCLASSIFIED	21. No. of Pages 26	22. Price

TABLE OF CONTENTS

<u>Section</u>		<u>Page No.</u>
1	Purpose of Compliance Test	1-1
2	Test Procedure and Discussion of Results	2-1
3	Test Data	3-1
	Data Sheet 1 – All Vehicles	3-2
	Data Sheet 2 – Automatic Transmission Vehicles	3-4
	Data Sheet 3 – Special Devices	3-6
4	Test Equipment List and Calibration Due Dates	4-1
5	Photographs	5-1
	Figure 1: Vehicle Left Front Three-Quarter View	5-2
	Figure 2: Vehicle Certification Placard	5-3
	Figure 3: Vehicle Tire Placard	5-4
	Figure 4: Close-Up Of Ignition Switch	5-5
	Figure 5: Close-Up Of Transmission Shift Lever Mechanism	5-6
6	Vehicle Owner's Manual	6-1

SECTION 1

PURPOSE OF COMPLIANCE TEST

This test is part of the Federal Motor Vehicle Safety Standard (FMVSS) 114 Compliance Test Program conducted for the National Highway Traffic Safety Administration (NHTSA) by General Dynamics Advanced Information Engineering Services under Contract No. DTNH22-01-C-01025. The purpose of this test was to determine if the subject vehicle, a 2004 Mitsubishi Endeavor 4-door MPV, was in compliance with FMVSS No. 114, Theft Protection. The purpose of this standard is to reduce the incidence of crashes resulting from unauthorized operation of vehicles by specifying requirements for theft protection. Additionally, FMVSS No. 114 specifies requirements to reduce the incidents of crashes from rollaway of parked vehicles with automatic transmissions as a result of children moving the shift mechanism out of the "park" position. This standard applies to passenger cars, trucks and multipurpose passenger vehicles having a Gross Vehicle Weight Rating (GVWR) of 4536 kilograms or less. This compliance test was conducted using the requirements found in the OVSC Laboratory Test Procedure No. TP-114-01, dated December 17, 1997.

SECTION 2

TEST PROCEDURE AND DISCUSSION OF RESULTS

A 2004 Mitsubishi Endeavor 4-door MPV with an automatic transmission was subjected to FMVSS No. 114 testing in accordance with the NHTSA Office of Vehicle Safety Compliance (OVSC) Laboratory Test Procedure TP-114-01, dated December 17, 1997. This test was performed by General Dynamics Advanced Information Engineering Services on April 13, 2004.

The test equipment used for this test included a standard metric tape ruler, a digital inclinometer with digital clinometer function, weight scales and a digital manometer. Testing was performed in the following sequence:

KEY LOCKING SYSTEM REQUIREMENT (S4.2):

The key locking system with the key removed, did prevent normal activation of the vehicle's engine. Both steering and forward self mobility were prevented.

WARNING ALARM REQUIREMENT (S4.5):

With the key left in the locking system and the driver's door opened, an audible alarm was activated. This "warning to the driver" was verified in all ignition switch positions except "on" and "start".

"PARK" POSITION REQUIREMENT (S4.2.1(a)(2)):

The key locking system only permitted removal of the key when the automatic transmission shift lever was locked in "park". Key removal was attempted in all shift lever positions. On this vehicle, the transmission shift lever would not remain between detent positions without assistance.

TEN PERCENT GRADE "PARK" REQUIREMENT (S4.2.1(a)(3))

The vehicle was driven forward and stopped with the service brakes on a 10.8% grade. The parking brake was fully applied and the transmission lever was placed in "park". When the service and parking brakes were released the vehicle moved 0 mm (150 mm maximum is allowed on a 10% grade). Since the available test grade was more stringent than the specified condition, the subject vehicle appeared to perform within the safety performance requirements.

SPECIAL DEVICES REQUIREMENT (S4.2.2):

The test vehicle was not equipped with any special devices.

"OUT OF PARK" POSITION REQUIREMENT (S4.3):

Starting from the condition of the engine running at idle with the transmission shift lever in the "drive" position, the steering wheel remained unlocked and the vehicle was free to roll with the transmission shift lever in each position except "park" or "reverse" when the key locking system was turned to the "lock" position.

FMVSS 114, THEFT PROTECTION

DATA SHEET 1 - ALL VEHICLES

TEST DATE: April 13, 2004 LAB: General Dynamics
 CONTRACT: DTNH22-01-C-01025 VEHICLE NHTSA NUMBER: C45601
 VIN: 4A4MM21S44E034123 BUILD DATE: 08/03
 MY/MAKE/MODEL/BODY STYLE: 2004 Mitsubishi Endeavor 4-door MPV

LOCATION OF KEY LOCKING SYSTEM: The key locking system consisted of an ignition switch mounted on the right side of steering column and a transmission shift lever that was located on the center console mounted to the vehicle floor.

TRANSMISSION TYPE:


Automatic X ; Manual - ; Other (describe: N/A)

DRIVE TRAIN TYPE:

Front Wheel X ; Rear Wheel - ; Four Wheel -

OPTIONAL RELEASE DEVICES:

Key - ; Transmission - ; None X

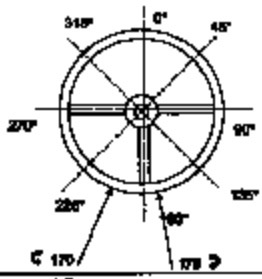REQUIREMENT S4.2		PASS	FAIL
Engine cannot be started without utilizing the ignition key.		X	-
With key removed, steering wheel locks: Yes <u>X</u> ; No <u>-</u> Identify locking position on wheel using an arrow. <u>Clockwise - 179°</u> <u>Counterclockwise - 170°</u>			
			
Key removal prevents forward self mobility: Yes <u>X</u> ; No <u>-</u> If yes describe: <u>Automatic transmission remains in "park" position.</u>			
Locking system, with key removed prevents starting the engine and either steering or self mobility or both.		X	-


FMVSS 114, THEFT PROTECTION

DATA SHEET 1 - ALL VEHICLES (continued)

REQUIREMENT S4.5	PASS	FAIL
Warning system is activated when the ignition key is left in any switch position except "on" and "start" and the driver's door is opened.	X	

REMARKS:

Ignition Switch Positions: (refer to page 6-2 of this report for a description of the switch positions provided in the vehicle owner's manual).

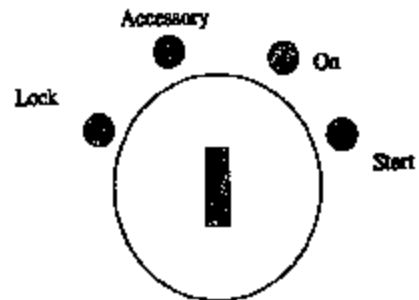

RECORDED BY: James Czarniecki DATE: April 13, 2004
 APPROVED BY: [Signature]

FMVSS 114, THEFT PROTECTION

DATA SHEET 2 – AUTOMATIC TRANSMISSION VEHICLES ONLY

TEST DATE: April 13, 2004 LAB: General Dynamics
 CONTRACT: DTNH22-01-C-01025 VEHICLE NHTSA NUMBER: C45601
 VIN: 4A4MM21S44E034123 BUILD DATE: 08/03
 MY/MAKE/MODEL/BODY STYLE: 2004 Mitsubishi Endeavor 4-door MPV

VEHICLE TEST WEIGHT* (kg): 1844.5 WEIGHT OF DRIVER AND BALLAST (kg): 91

FUEL TANK LEVEL: 100 (% OF MAX)

*with driver and ballast

TIRE PRESSURE:

Vehicle Manufacturer Recommended (kPa): Front 220 ; Rear 220

Measured (kPa): LF 220 ; LR 220 ; RF 220 ; RR 220

REQUIREMENT S4.2.1(a)(2)	PASS	FAIL
Key locking system prevents key removal from any shift mechanism detent position except "park".	X	SEE NOTE
Key locking system prevents key removal from any position between the detent positions where the shift mechanism will remain without assistance.	X	SEE NOTE
NOTE: In the event that the key can be removed at any of the transmission shift lever positions, the vehicle's transmission or transmission shift lever shall become locked in "park" as the direct result of removing the key. If such a mechanism exists, describe the mechanism and its function:	N/A	
System prevents movement of the shift mechanism out of "park" position after removal of key.	X	

FMVSS 114, THEFT PROTECTION

DATA SHEET 2 – AUTOMATIC TRANSMISSION VEHICLES ONLY (continued)

REQUIREMENTS S4.2.1(a)(3)	PASS	FAIL
With the transmission in "park" measure movement of the vehicle down the slope upon releasing the service brake.	X	SEE NOTE
Test grade: <u>10.8</u> % (9 to 15 %)		
Measured movement: <u>0</u> mm (150 mm maximum)		
NOTE: Repeat procedure if vehicle fails on a grade in excess of 10%.		
Test grade: <u>-</u> % (9 to 10 %)	N/A	N/A
Measured movement: <u>-</u> mm (150 mm maximum)		

REQUIREMENT S4.3	PASS	FAIL
Transmission in any position other than "park" or "reverse" and the key locking system in the "lock" position. The steering wheel must remain unlocked and the vehicle must remain free to roll.	X	-

REMARKS:

RECORDED BY:

James Czafnecki

DATE:

April 13, 2004

APPROVED BY:



FMVSS 114, THEFT PROTECTION

DATA SHEET 3 - SPECIAL DEVICES

TEST DATE: April 13, 2004 LAB: General Dynamics
 CONTRACT: D1NH22-01-C-01025 VEHICLE NHTSA NUMBER: C45601
 VIN: 4A4MM21S44E034123 BUILD DATE: 08/03
 MY/MAKE/MODEL/BODY STYLE: 2004 Mitsubishi Endeavor 4-door MPV

REQUIREMENTS S4.2.2(a)	PASS	FAIL
Electrical failure capability permits ignition key removal with transmission shift lever in other than "park" position. Yes <u>-</u> No <u>-</u> Upon key removal steering wheel locks.	N/A	N/A
Device permits key removal when the transmission is in other than the "park" position. Yes <u>-</u> No <u>-</u> The means for activating this device is covered by a non-transparent surface which prevents sight and activation of the device. The non-transparent surface is removable only by use of a screwdriver or other tool. Describe the device, its cover and its location: <u>Not applicable</u> Describe how the device is activated: <u>Not applicable</u> Upon key removal, steering wheel locks.	N/A	N/A

REMARKS:

Test vehicle is not equipped with this special device.

FMVSS 114, THEFT PROTECTION
DATA SHEET 3 - SPECIAL DEVICES (continued)

REQUIREMENTS S4.2.2(b)	PASS	FAIL
Device permits moving the transmission shift lever from "park" after key removal. Yes <u>-</u> No <u>-</u>		
The means for activating this device is covered by a non-transparent surface which prevents sight and activation of the device. The non-transparent surface is removable only by use of a screwdriver or other tool.	N/A	N/A
Describe the device, its cover and its location: <u>Not applicable</u>		
Describe how the device is activated: <u>Not applicable</u>		
Upon device activation, the steering wheel remains locked.	N/A	N/A

REMARKS:

Test vehicle is not equipped with this special device.

RECORDED BY:

APPROVED BY:

James Czarnocki


DATE:

April 13, 2004

SECTION 4**TEST EQUIPMENT LIST AND CALIBRATION DATES**

Equipment	Manufacturer	Name	Range	Accuracy	Calibration Date	Calibration Due
Clinometer	MD	Smart Level	0-100%	0.1%	3/29/2004	3/29/2005
Steel Tape	Stanley	Stanley 3137	3 meters	0.5mm	N/A	N/A
Weight Scales	Long Acre	Computer Scales 2000	0-12,000lbs.	0.2%	11/25/2003	11/25/2004
Manometer	Meriam Instrument Co.	350 Smart Manometer	0-200 psi.	0.05%	8/3/2003	8/3/2004
Plumb Bob	Stanley	Plumb bob	N/A	N/A	N/A	N/A

SECTION 5

PHOTOGRAPHS

TABLE OF PHOTOGRAPHS

<u>Figure</u>	<u>Photograph Title</u>	<u>Page</u>
Figure 1	VEHICLE LEFT FRONT THREE-QUARTER VIEW	5- 2
Figure 2	VEHICLE CERTIFICATION PLACARD	5- 3
Figure 3	VEHICLE TIRE PLACARD	5- 4
Figure 4	CLOSE-UP OF IGNITION SWITCH	5- 5
Figure 5	CLOSE-UP OF TRANSMISSION SHIFT LEVER MECHANISM	5- 6



Report 1, Volume 1, All Japan Trade Center, Tokyo

2004 Mitsubishi Electric + Co. Ltd.

NTN-A-2004-00001

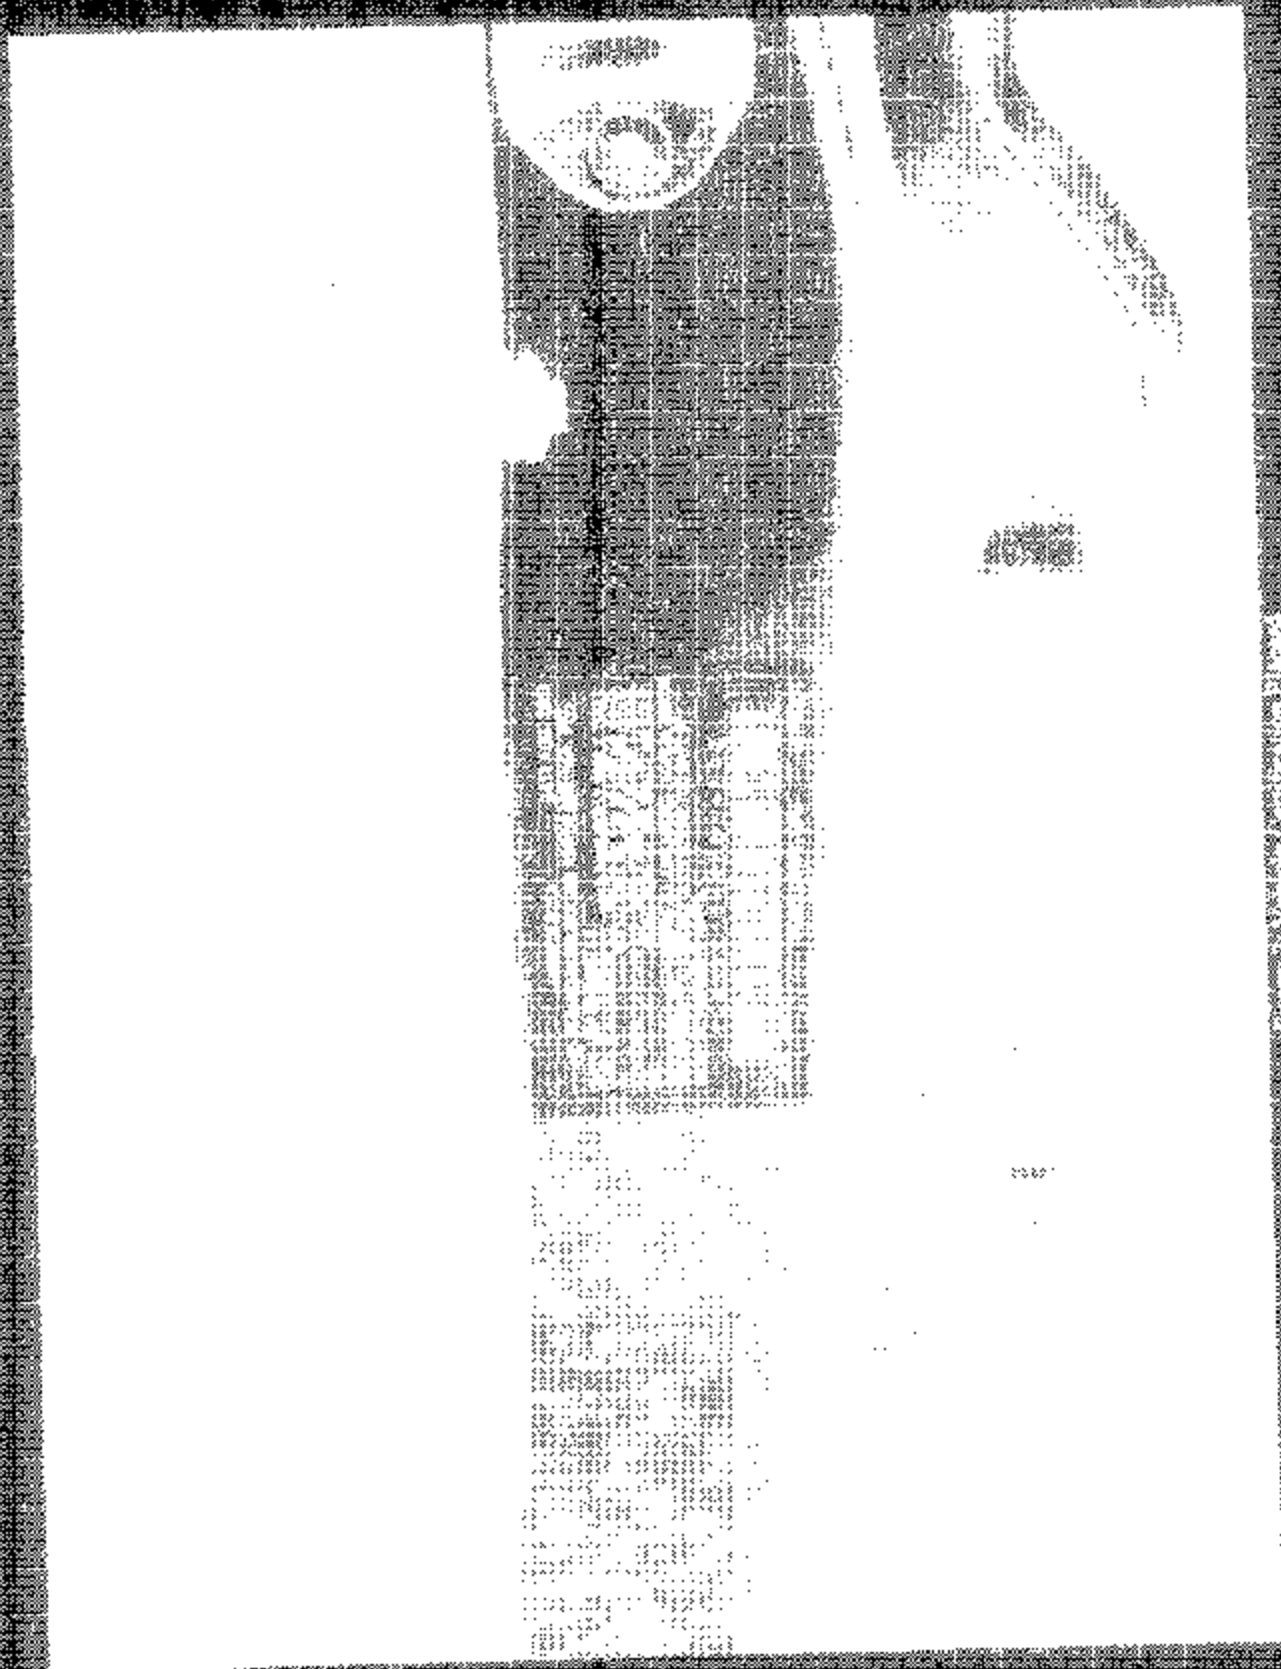


Figure 1. Vehicle Collision Point

2004 Mitsubishi Endeavor 4-door MPV

10/15/04, 2:00, 0.000

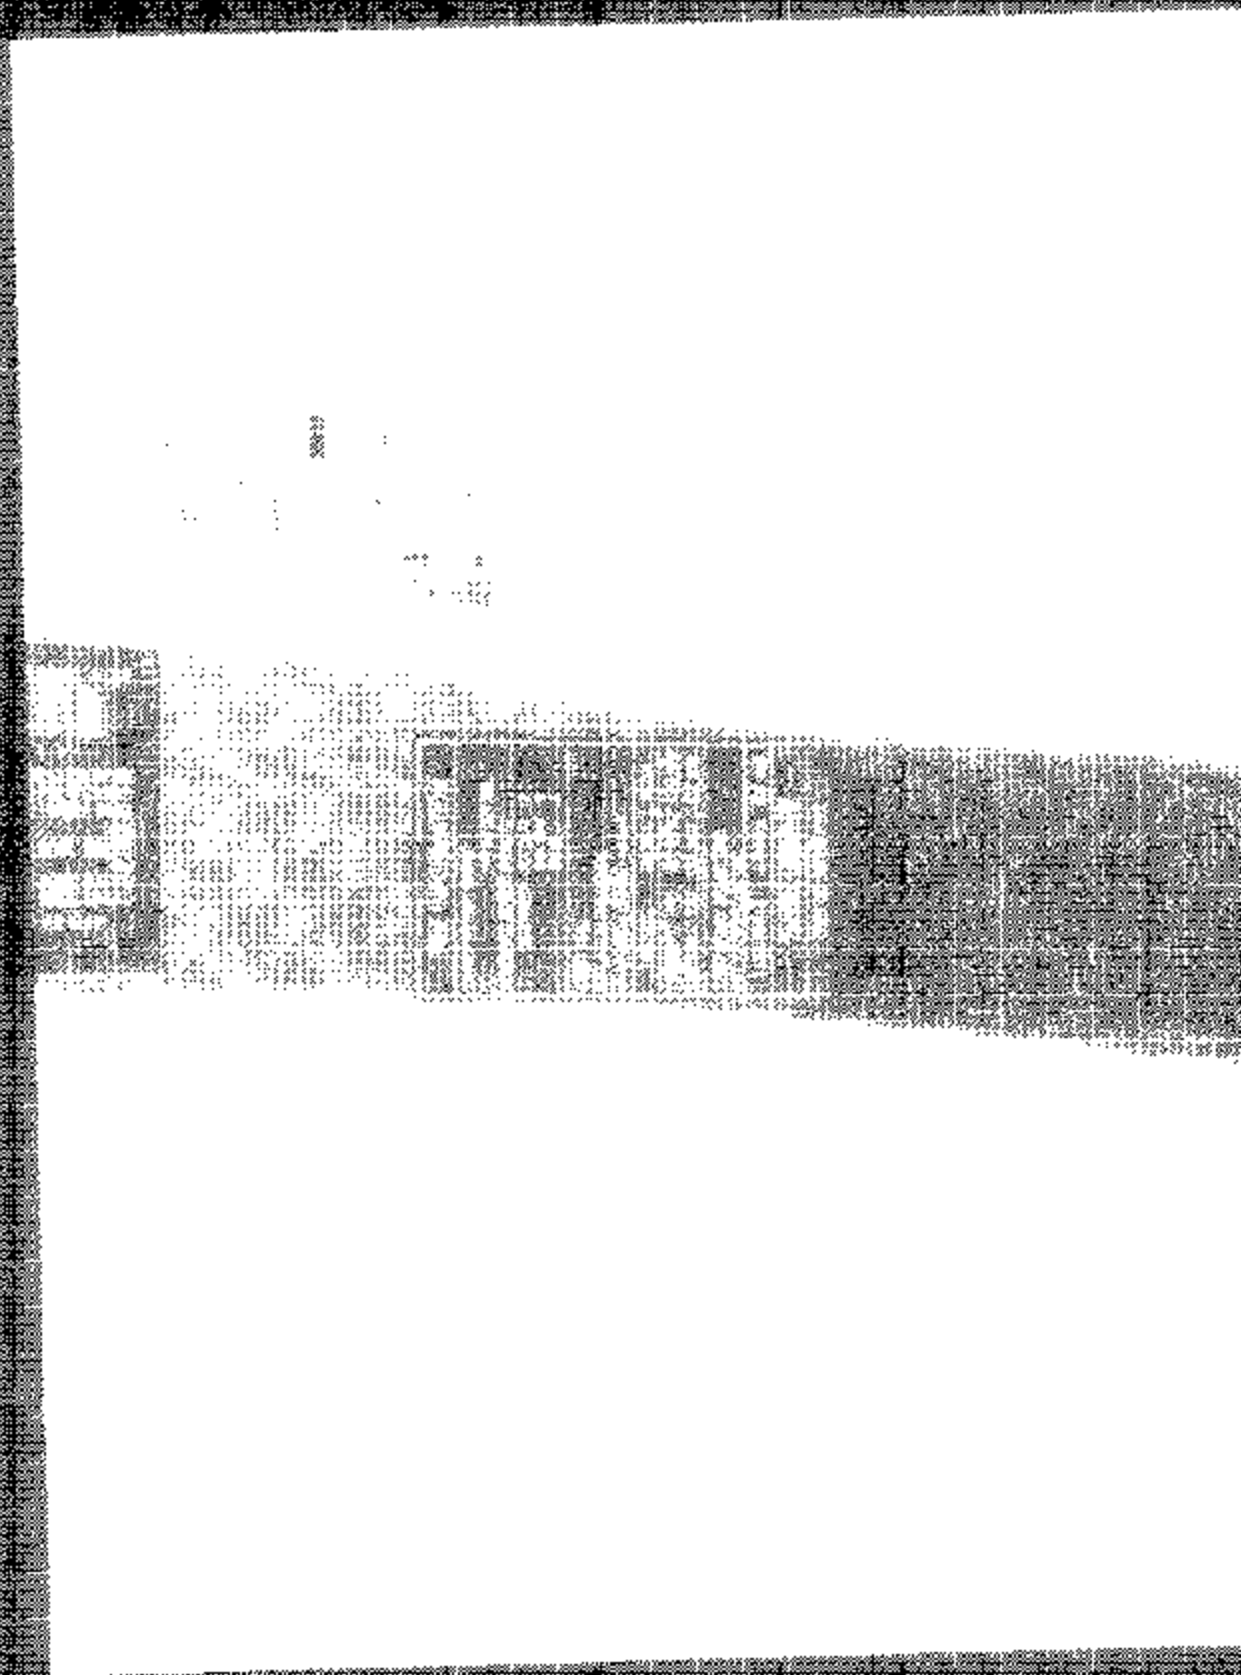


Figure 2: Vehicle 1 (see Table 1)
2004 Mitsubishi Endeavor (4-door JVT)
JUSTIN, Mo. (C/150)

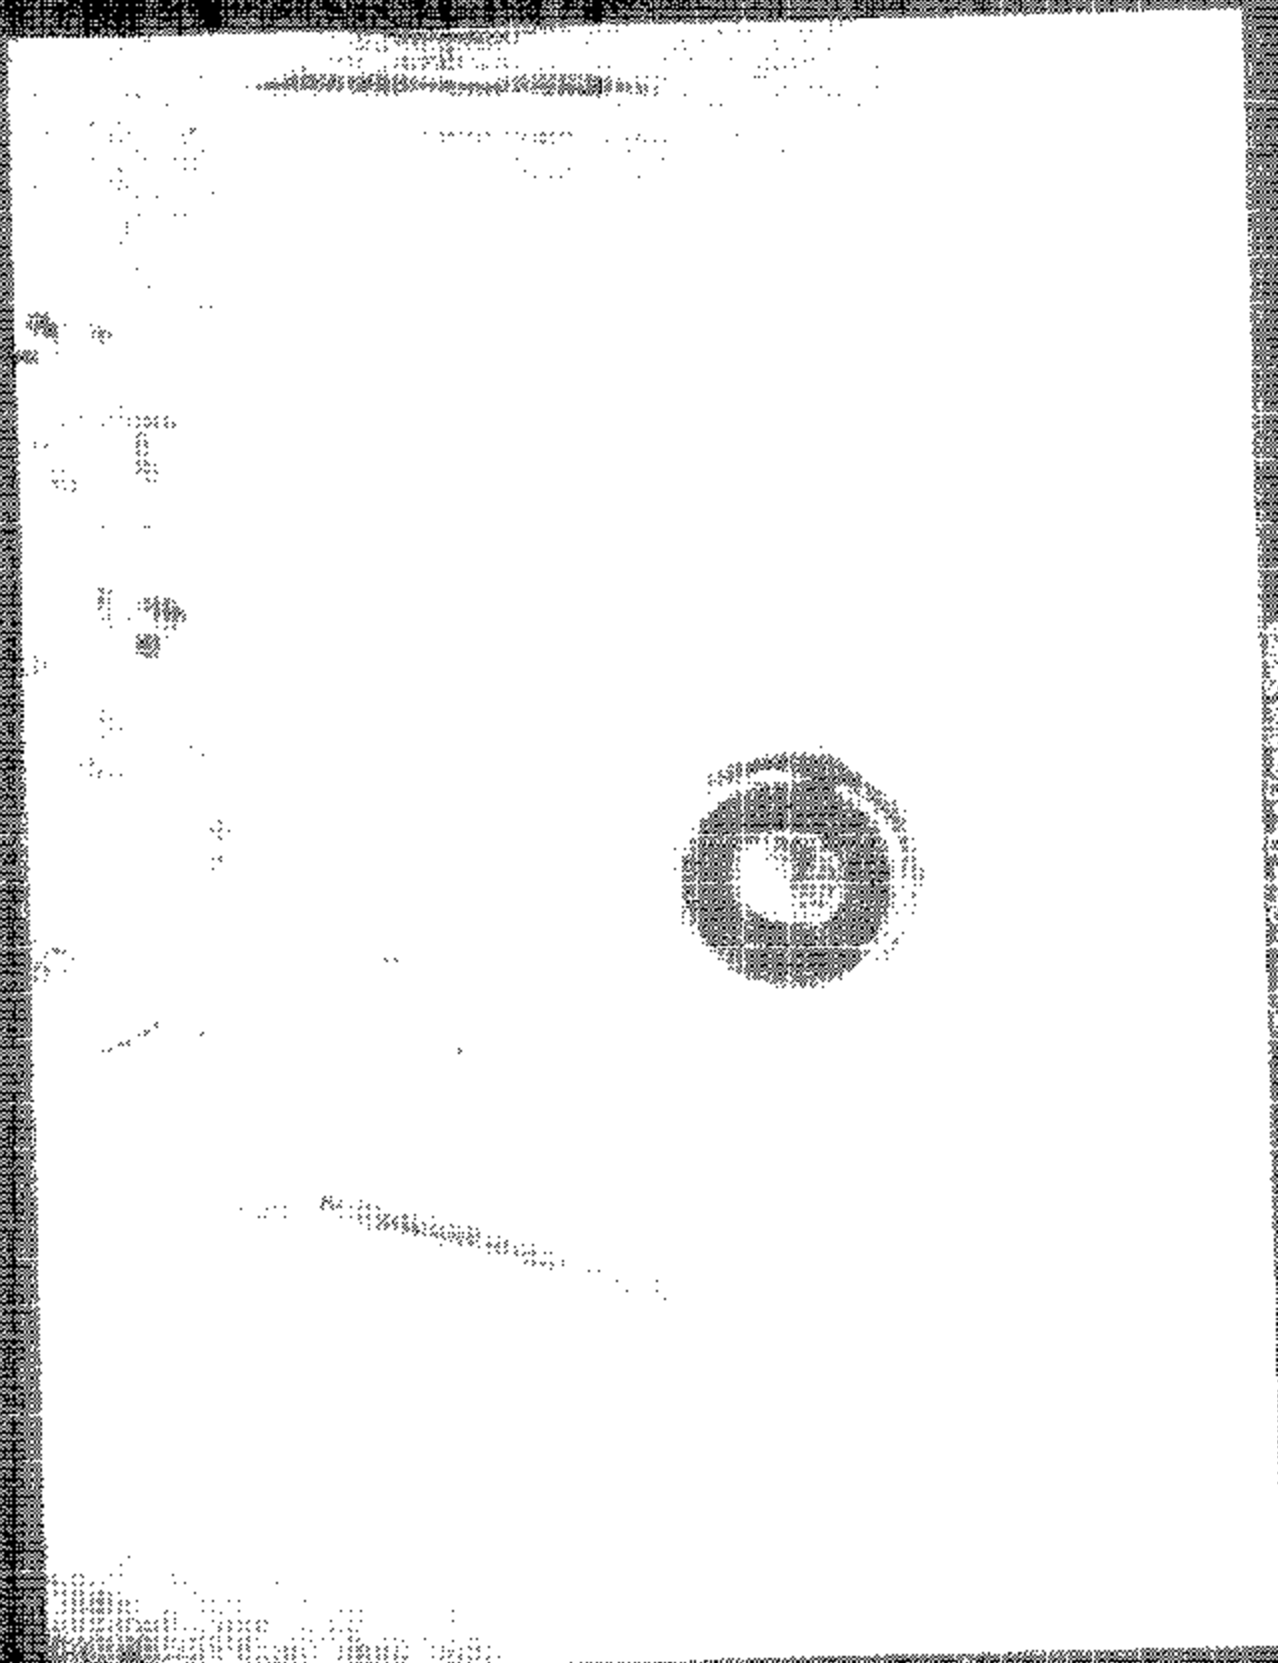


Figure 1: Close-up of Camera Lens

2004, Mammalian Research, 4, 100-104

NITSA No. 000001


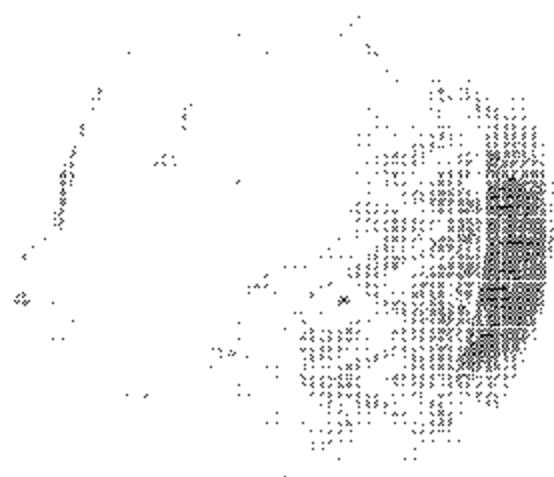



Figure 5: Close-Up of Transmission Still After Explosion


2004 Mission Exhibit A-G-01 MPY
NITSA PC-01698

SECTION 6

VEHICLE OWNER'S MANUAL

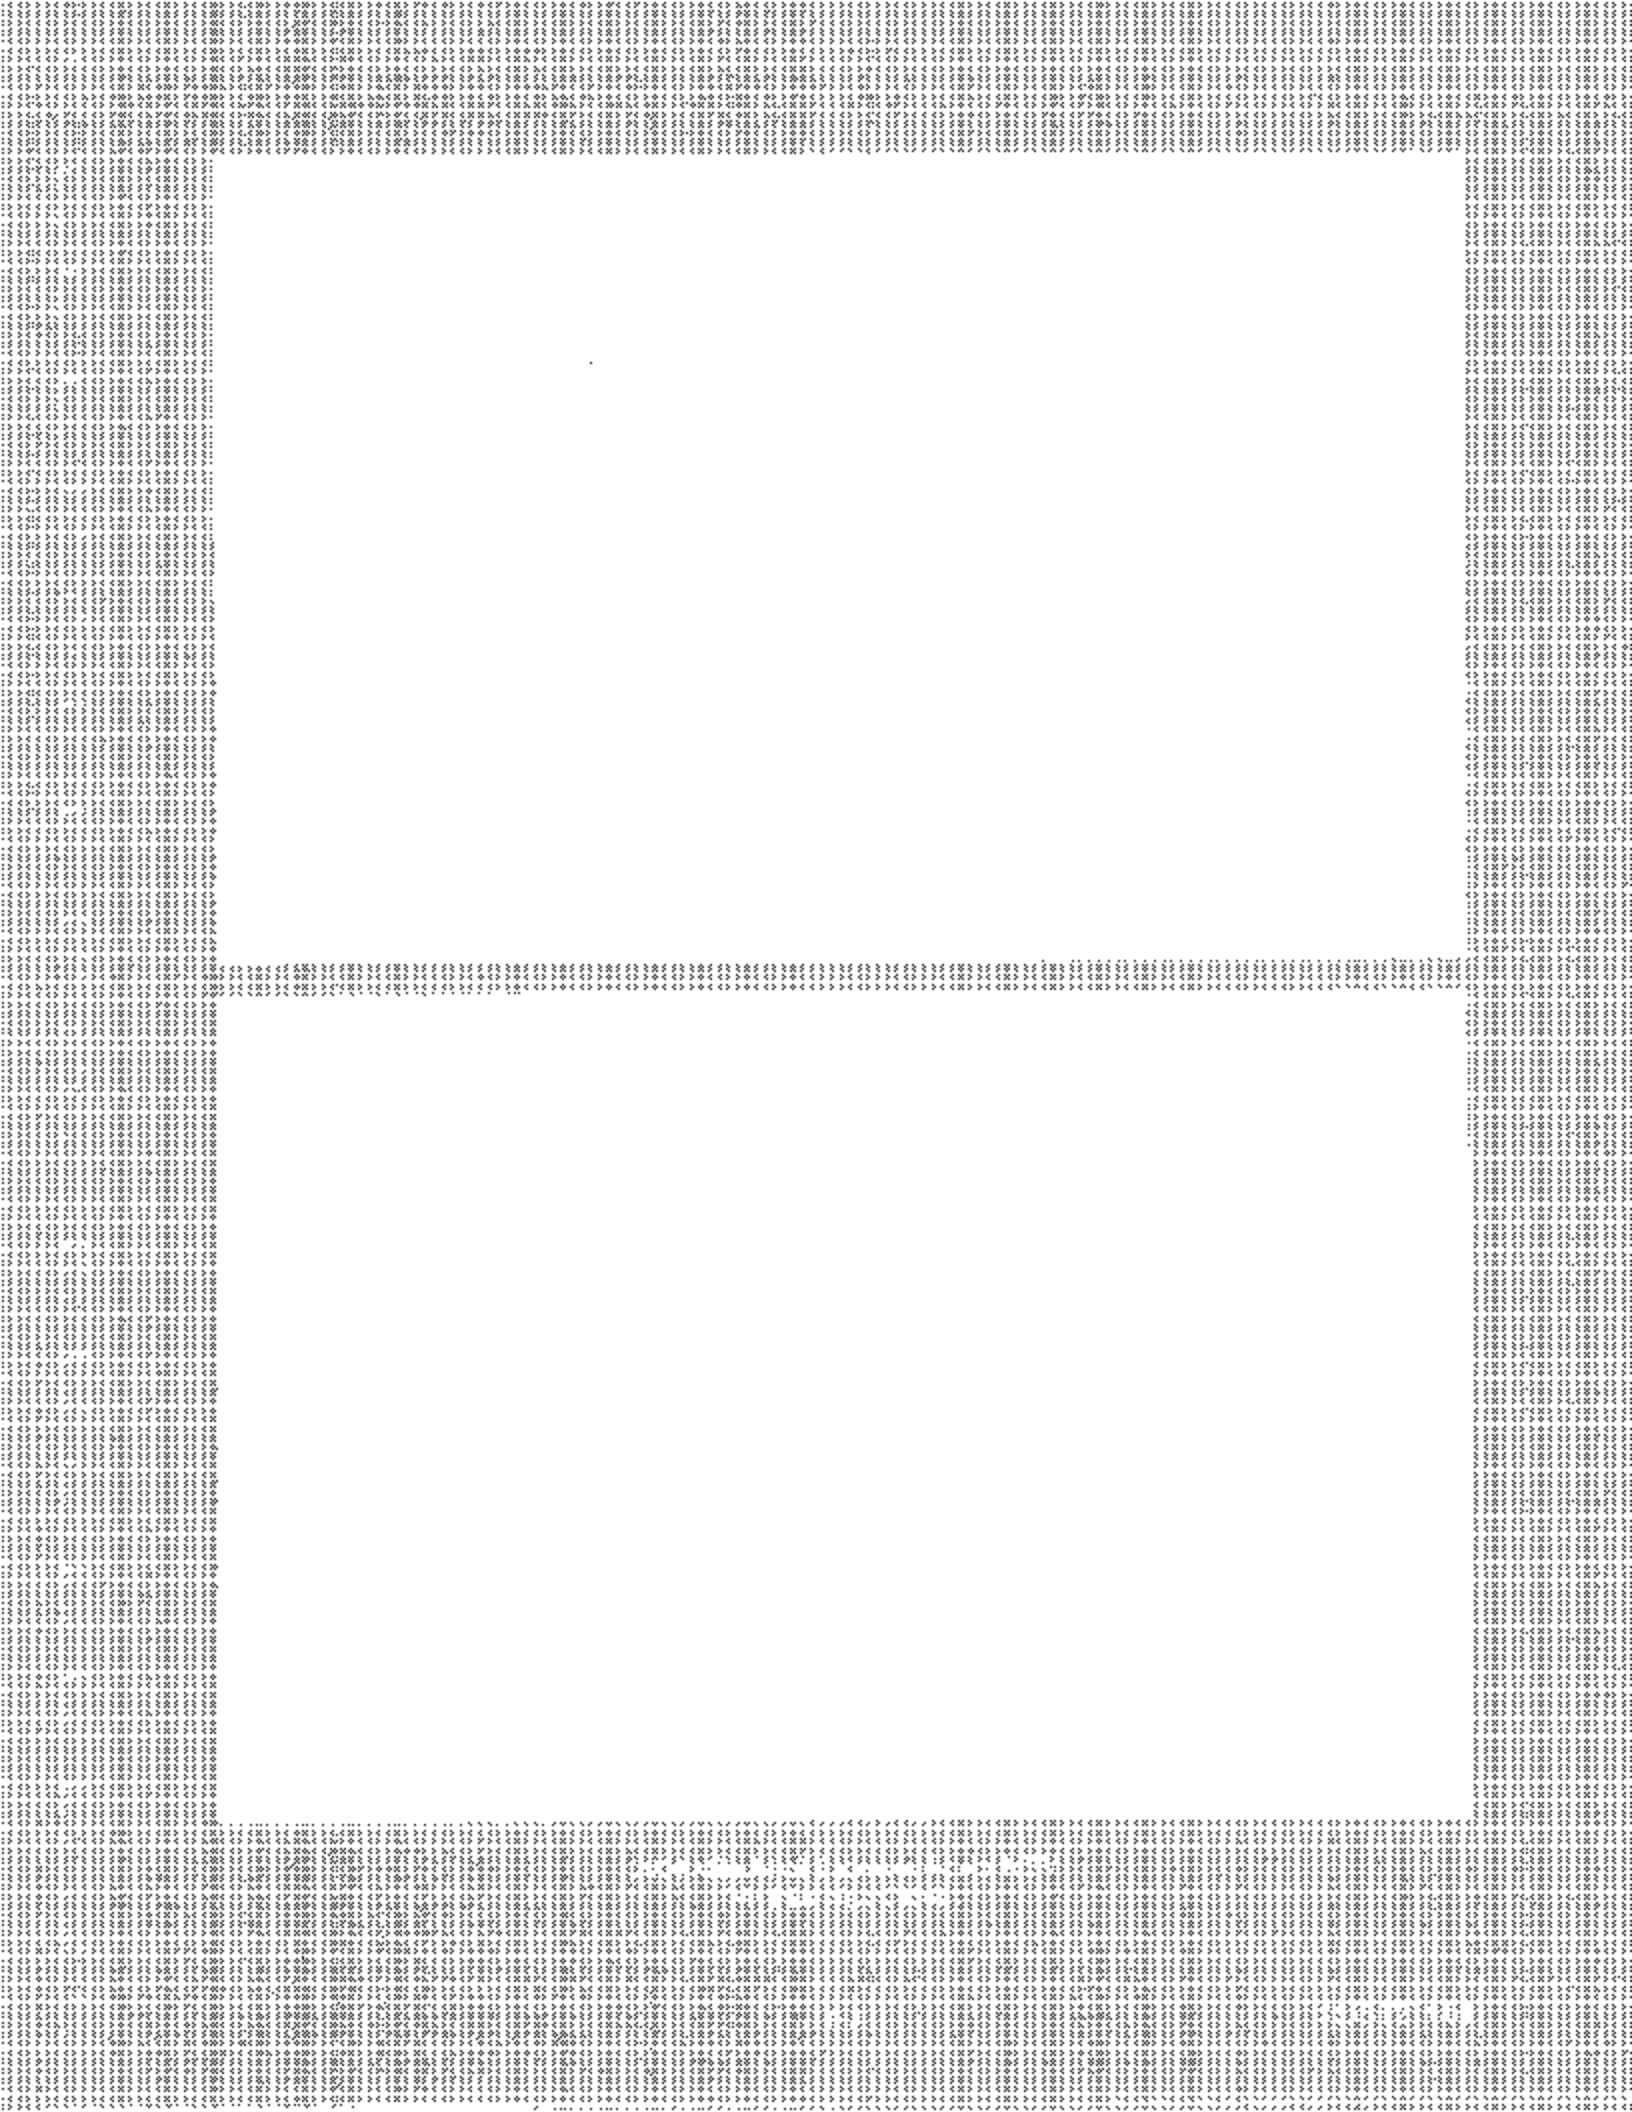

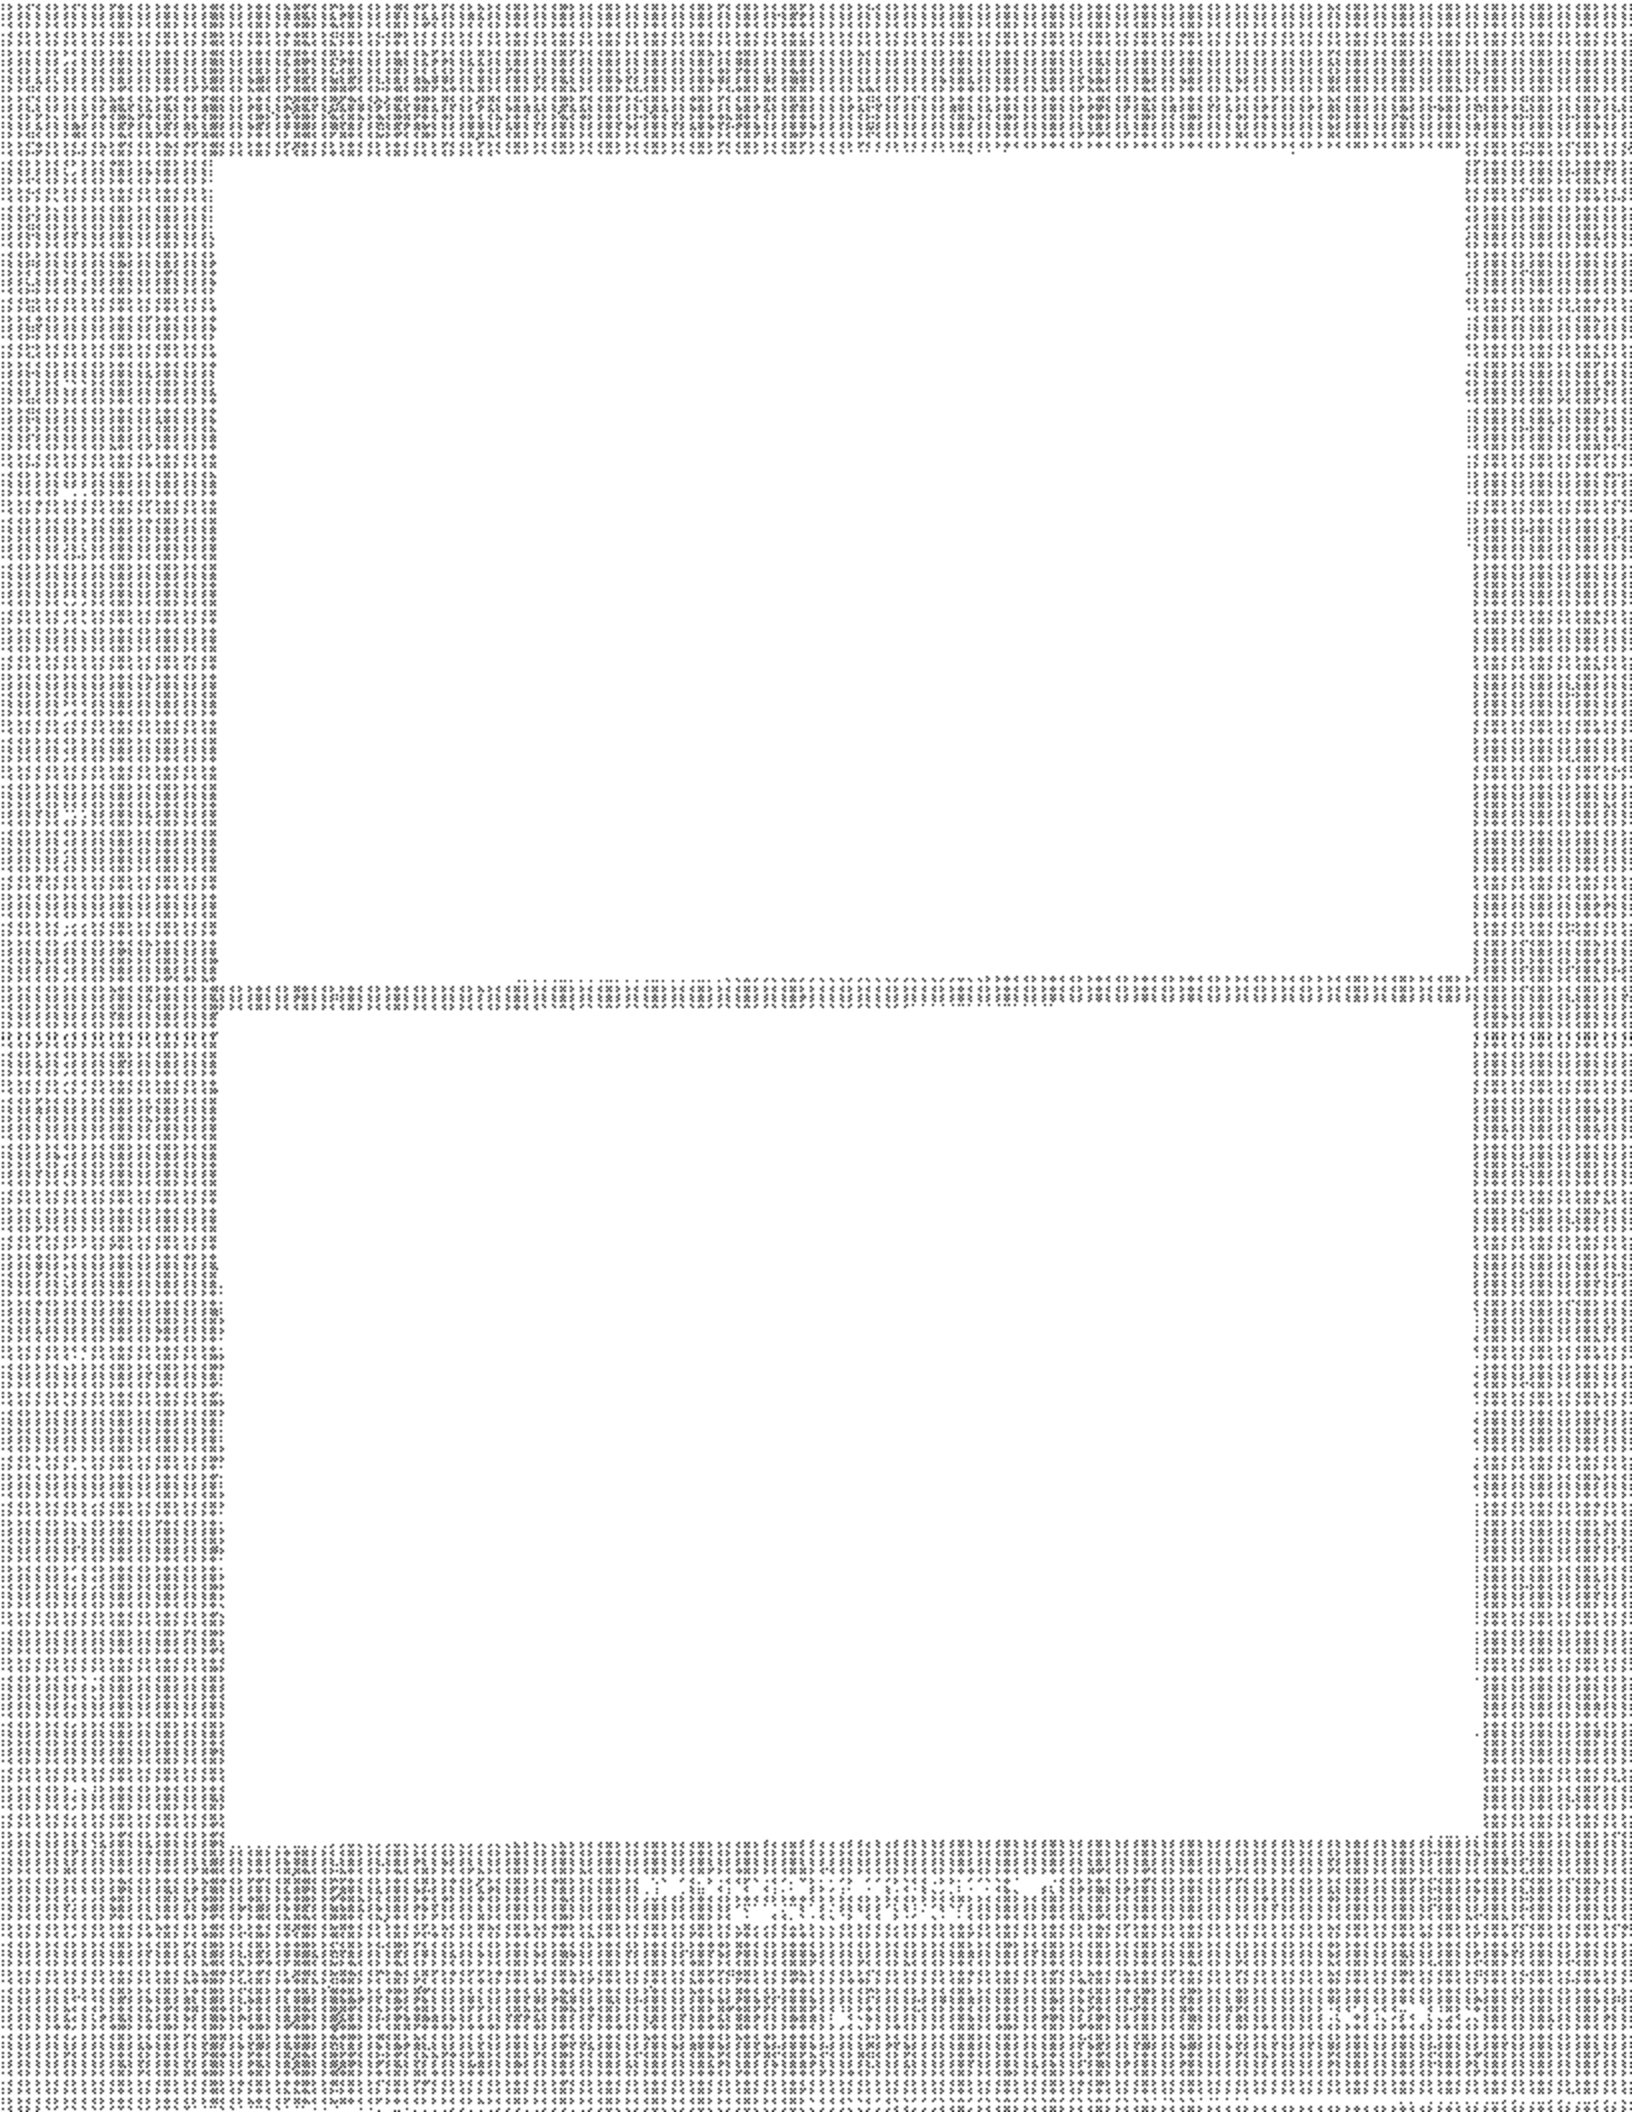

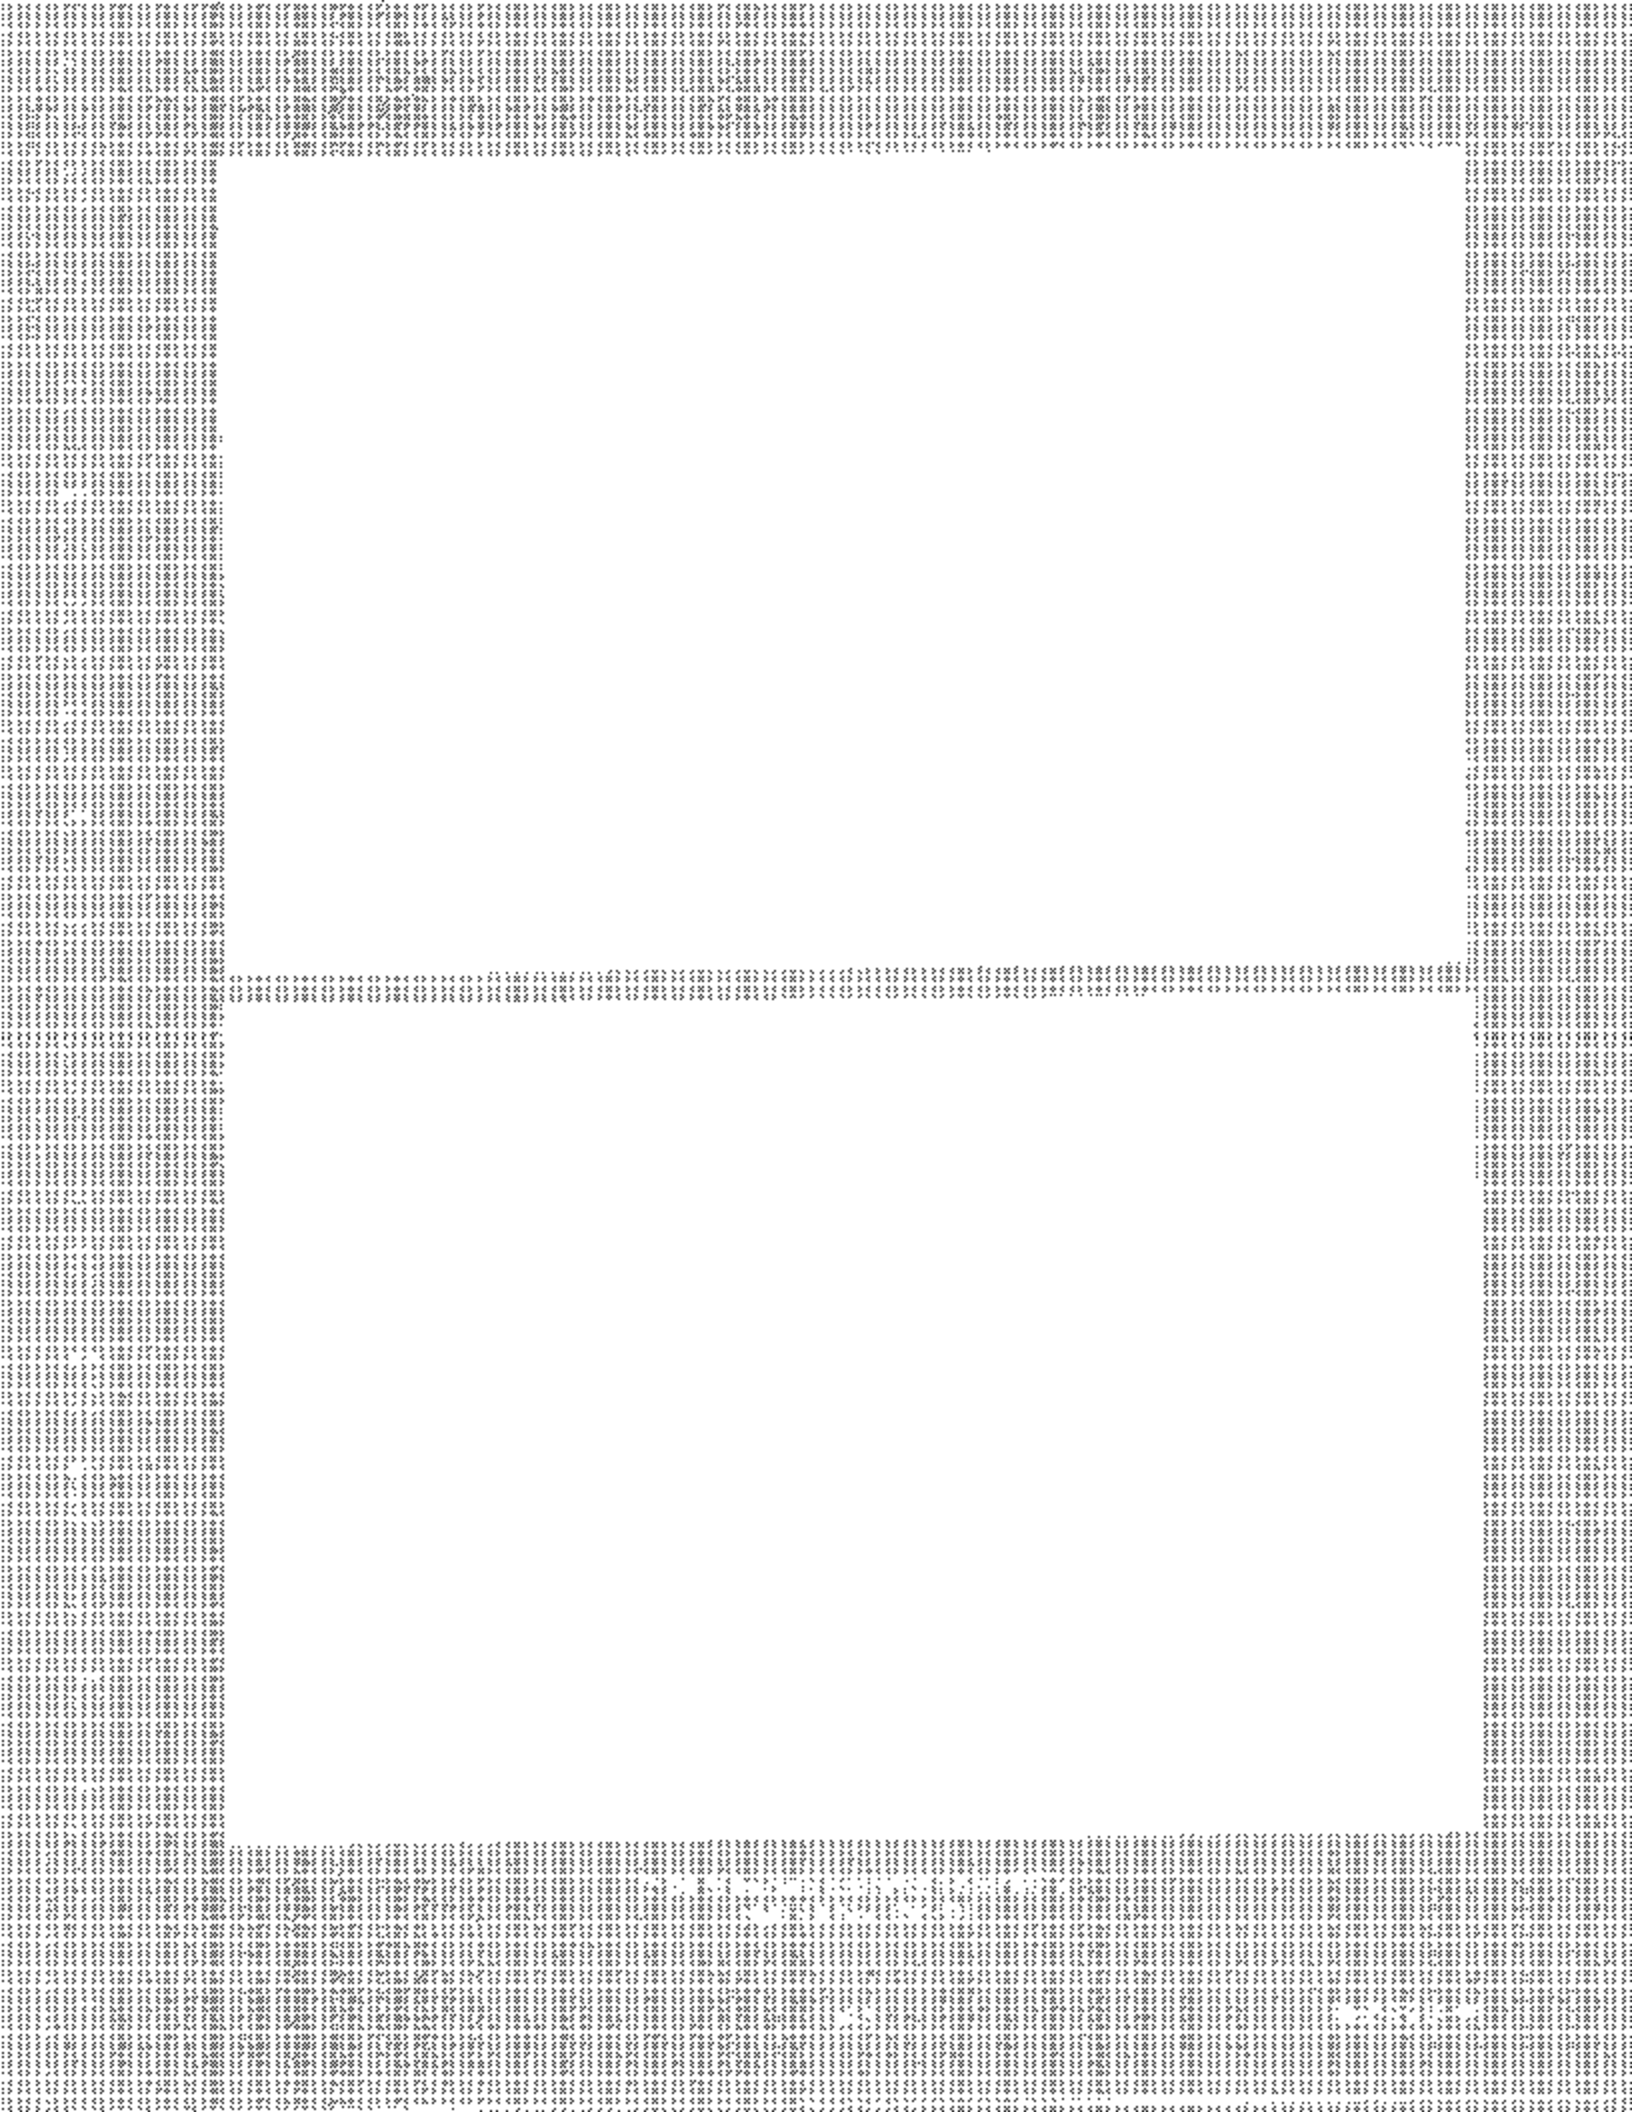

[illegible]